

Please read the following bulletin with the understanding that even if the issue detailed within is not present, any ECM updates related to fuel system operation should be performed before replacing any catalytic converter for any reason.

In this case, even if not severe enough to cause an engine “stumble”, unmetered fuel entering the engine will cause an overall rich condition which is very likely to damage the catalytic converter.

## **ENGINE CONTROLS/FUEL SYS - STALLING/STUMBLING AFTER STOP**

02-075

October 22, 2011

Applies To:

See VEHICLES AFFECTED

Engine Stumbles or Stalls After a Stop

(Supersedes 02-075, dated July 23, 2011, to update the information marked by asterisks)

### REVISION SUMMARY

\*Under WARRANTY CLAIM INFORMATION, a flat rate time was changed.\*

### SYMPTOM

When the fuel tank is about 3/4 full, the engine may stumble or stall after the vehicle comes to a stop.

## PROBABLE CAUSE

Fuel sloshing in the tank causes a purge of fuel vapors to enter the engine.

### VEHICLES AFFECTED

2002 CR-V: ALL

2003 CR-V

*2WD:*

From VIN JHLRD6...3C000001 thru  
JHLRD6...3C006063

From VIN SHSRD6...3U100001 thru  
SHSRD6...3U103467

*4WD M/T:*

From VIN JHLRD77..3C000001 thru  
JHLRD77..3C016311

From VIN SHSRD77..3U100001 thru  
SHSRD77..3U120012

*4WD A/T:*

From VIN JHLRD78..3C000001 thru  
JHLRD78..3C016308

From VIN SHSRD78..3U100001 thru  
SHSRD78..3U120132

---

## **CORRECTIVE ACTION**

Update the vehicle's ECM/PCM software from your December '02 or later Interactive Network (iN) CD.

## **WARRANTY CLAIM INFORMATION**

Operation Number: 125517

\*Flat Rate Time: 0.3 hour\*

Failed Part: P/N 37820-PPA-A65

Defect Code: 07201

Symptom Code: 09304

Skill Level: Repair Technician

## **REPAIR PROCEDURE**

\*Update the ECM/PCM software. Refer to Service Bulletin 01-023, Updating Control Units/Modules.\*